

Date: Wednesday, 07/05/2008 11:55:39 AM  
 User: Julie Lecocq

## Process Sheet

<b>Customer</b>	: CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b>	: FLOAT SKIDTUBE ASSEMBLY
<b>Job Number</b>	: 39093		
<b>Estimate Number</b>	: 10309		
<b>P.O. Number</b>	:	<b>Part Number</b>	: D206642541
<b>This Issue</b>	: 07/05/2008	<b>S.O. No.</b>	:
<b>Prsht Rev.</b>	: NC	<b>Drawing Number</b>	: D3274 REV D
<b>First Issue</b>	: / /	<b>Project Number</b>	: N/A
<b>Previous Run</b>	: 36991A	<b>Drawing Revision</b>	: D
	<b>Type</b> : SKIDTUBES	<b>Material</b>	:
<b>Written By</b>	:	<b>Due Date</b>	: 21/05/2008
<b>Checked &amp; Approved By</b>	: <u>JUO 08.5.07</u>	<b>Qty:</b>	1 Um: Each
<b>Comment</b>	: Est Rev:B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev:C 07-02-23 Added SS Wearplates & Gaskets JLM Est Rev:D 07-12-06 replace NAS1515H3L to D3672-1 DD Est Rev:E 08-04-17 as per PAR 08-015 DD verified by:		

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D206-642-541 CHG003

2.0	D26001190	Extrusion Round 3" 206
-----	-----------	------------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-1-190 3" OD Tube 31032 SL 8-6-2

3.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Bend FWD end of tube using bend prog D3274 FWD dwg D3274

2- Cut AFT end of tube at 170.9" as per dwg D3274 and deburr end.

3-Drill #40 Aft cap pilot hole using DT8025

4-Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274

5-Remove inner indexing ridge on aft end of skidtube as per Dwg D3274

6-Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

FWD

SL 8-6-2

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: - Wednesday, 07/05/2008 11:55:39 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

*Seq # 15 Breakdown*

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

*SL 8-6-2*

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*DD 8-6-2*

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*DD 8-6-2*

7.0

D3282041

Float Web (206L/407)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

*B-42213*

*ANM*

*8-10-1*

*(1x)*

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" and 0.375" crossbolt spacer holes using DT8743 as per Dwg D3274

2-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

3-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

*M109338*

Sikaflex expire date:

*8-11-01*

Start: *8-10-01*

Time:

*7:25*

Finish: *8-10-02*

Time:

*7:00 AM*

(Adhere for 12 hours)

*ANM 8-10-01*  
*8-9*

*SL 8-6-2*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 07/05/2008 11:55:39 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

9.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

508/10/02 (P70)

10.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Bend AFT end of tube using bend prog. D3274 AFT as per dwg D3274. Install drop pins in crossbolt spacer holes to maintain web position.

~~2-Remove inner indexing ridge on Fwd end of skidtube as per Dwg D3274.~~

3- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2  
OPEN HOLES TO .297"

4-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE  
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)  
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

5- Countersink crossbolt spacer holes as per Dwg D3274

(P70)

11.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

12.0	D32851	Cap
------	--------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3285-1

Fwd Cap

B 33902 BE 08/06/02

13.0	D2649	Cross Bolt Spacer
------	-------	-------------------



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

 



12 D2649

Crossbolt spacer

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D206-642-54 PAR #: N/A Fault Category: Prod / Sideline NCR: (Yes) No DQA: D Date: 08/10/06  
 QA: N/C Closed: D Date: 08/10/06

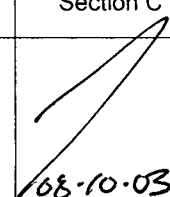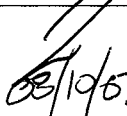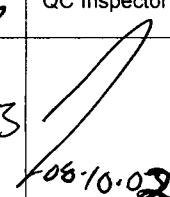NCR: <u>39093</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08-10-02	10.1	Loaded wrong program in bender operator error bent tube in ast end @ wrong location bend located @ 12.0" actual is supposed to be located @ 37.1"	 08/10/03	Scrap & destroy the tube no replace	AT 08-10-03	 08-10-03	 08/10/03	 08-10-02
		R.C: Employee error, <del>did not</del>						

NOTE: Date & initial all entries

Date: Wednesday, 07/05/2008 11:55:39 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

14.0	D32751	Crossbolt Spacer
------	--------	------------------



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D3275-1 Crossbolt spacer

15.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Weld Fwd Cap as per Dwg D3274 and QSI 004. Use aluminum rod.

A/R Aluminum Rod M107877 BE 08/06/02

2-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod \_\_\_\_\_

3-Grind welds flush to Fwd cap on top surface only.

4-Grind cross bolt welds flush as per Dwg D3274.

5-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

16.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

17.0	QC10	VISUAL INSPECTION OF GROUND WELDS
------	------	-----------------------------------



Comment: VISUAL INSPECTION OF GROUND WELDS

18.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

19.0	POWDER COATING	POWDER COATING
------	----------------	----------------



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME: \_\_\_\_\_

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 07/05/2008 11:55:39 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

OVEN TEMPERATURE: \_\_\_\_\_

FINISH TIME: \_\_\_\_\_

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

21.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3415-041 Nut Plate \_\_\_\_\_

22.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivet \_\_\_\_\_

23.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CR3212-4-03 Rivet \_\_\_\_\_

24.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

Batch: \_\_\_\_\_

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 \_\_\_\_\_

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 07/05/2008 11:55:40 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

A/R Sikaflex-291

Sikaflex expire date:

26.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Nut Plate & Inserts

27.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

BOLT

Batch:

28.0

D353515

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch:

29.0

D353523

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch:

30.0

D353535

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch:

31.0

D353539

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch:

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 07/05/2008 11:55:40 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

32.0	D353615	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: \_\_\_\_\_

33.0	D353623	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: \_\_\_\_\_

34.0	D353635	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: \_\_\_\_\_

35.0	D353639	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: \_\_\_\_\_

36.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: \_\_\_\_\_

37.0	D35373	Wearpad
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

38.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

80	AN960C10L	Washer	_____
----	-----------	--------	-------

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 07/05/2008 11:55:40 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

39.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
Washer  
batch \_\_\_\_\_

40.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
1 D3413-1 Ring \_\_\_\_\_

41.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
1 AN4C5A Bolt \_\_\_\_\_

42.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
1 AN960C416 Washer \_\_\_\_\_

43.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
1 D2646 Aft Cap \_\_\_\_\_

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291 \_\_\_\_\_

Sikaflex expire date: \_\_\_\_\_

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 07/05/2008 11:55:40 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 39093

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3 Batch: \_\_\_\_\_

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

A/R Sikaflex-291 \_\_\_\_\_

Sikaflex expire date: \_\_\_\_\_

45.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock

Location: \_\_\_\_\_

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-10-03

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

RELEASED

07.02.12

DESIGN CP	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED #	APPROVED #	DRAWING NO. D3274	REV. D SHEET 1 OF 4
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY SCALE NTS	
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER


## GENERAL NOTES:

1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291. ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1  
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL 130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINISH. ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.


STOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 39093

Copyright © 2004 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

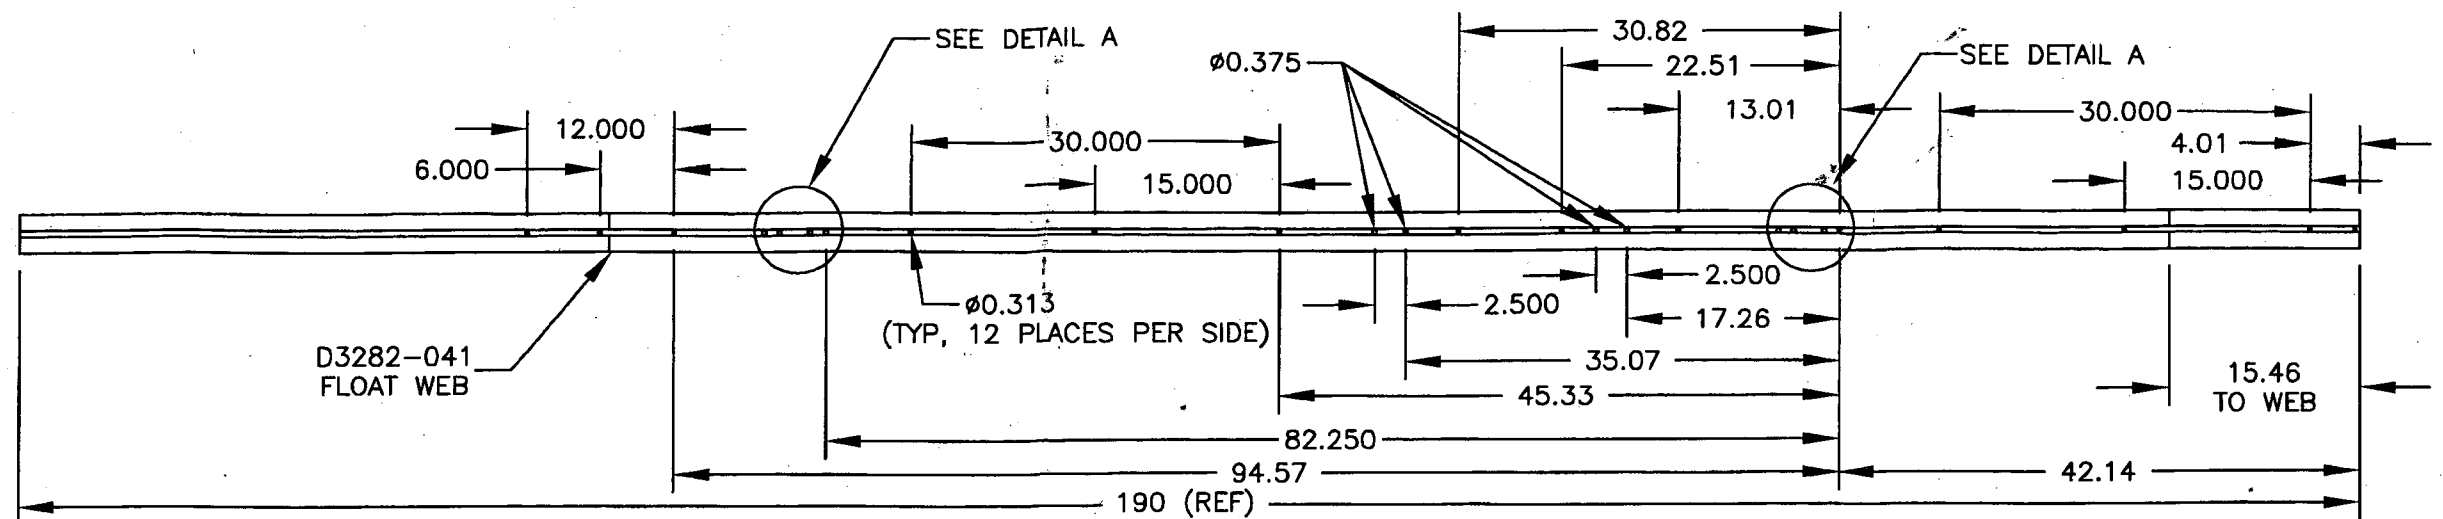

**D3274-041 DRILLING/ASSEMBLY DETAIL**

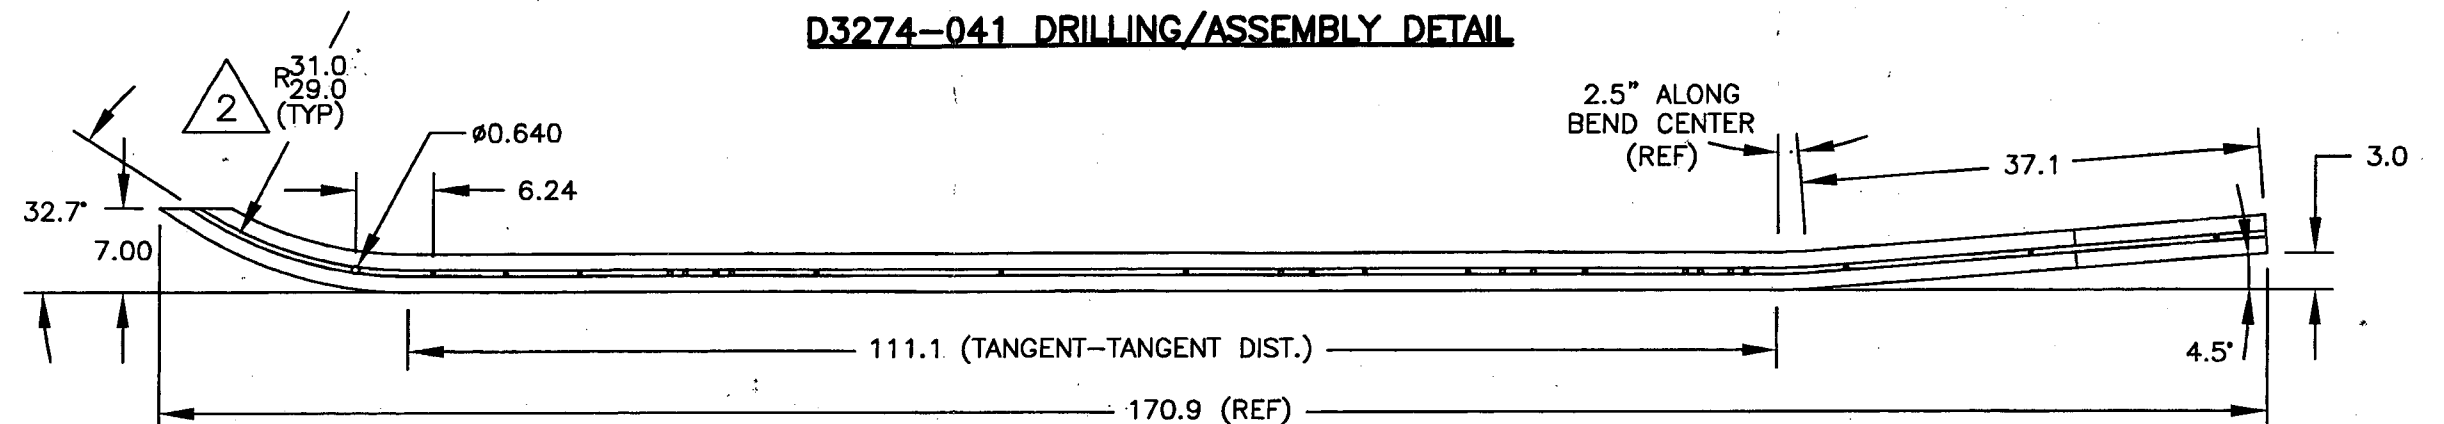

**D3274-041 BEND/DRILLING DETAIL**

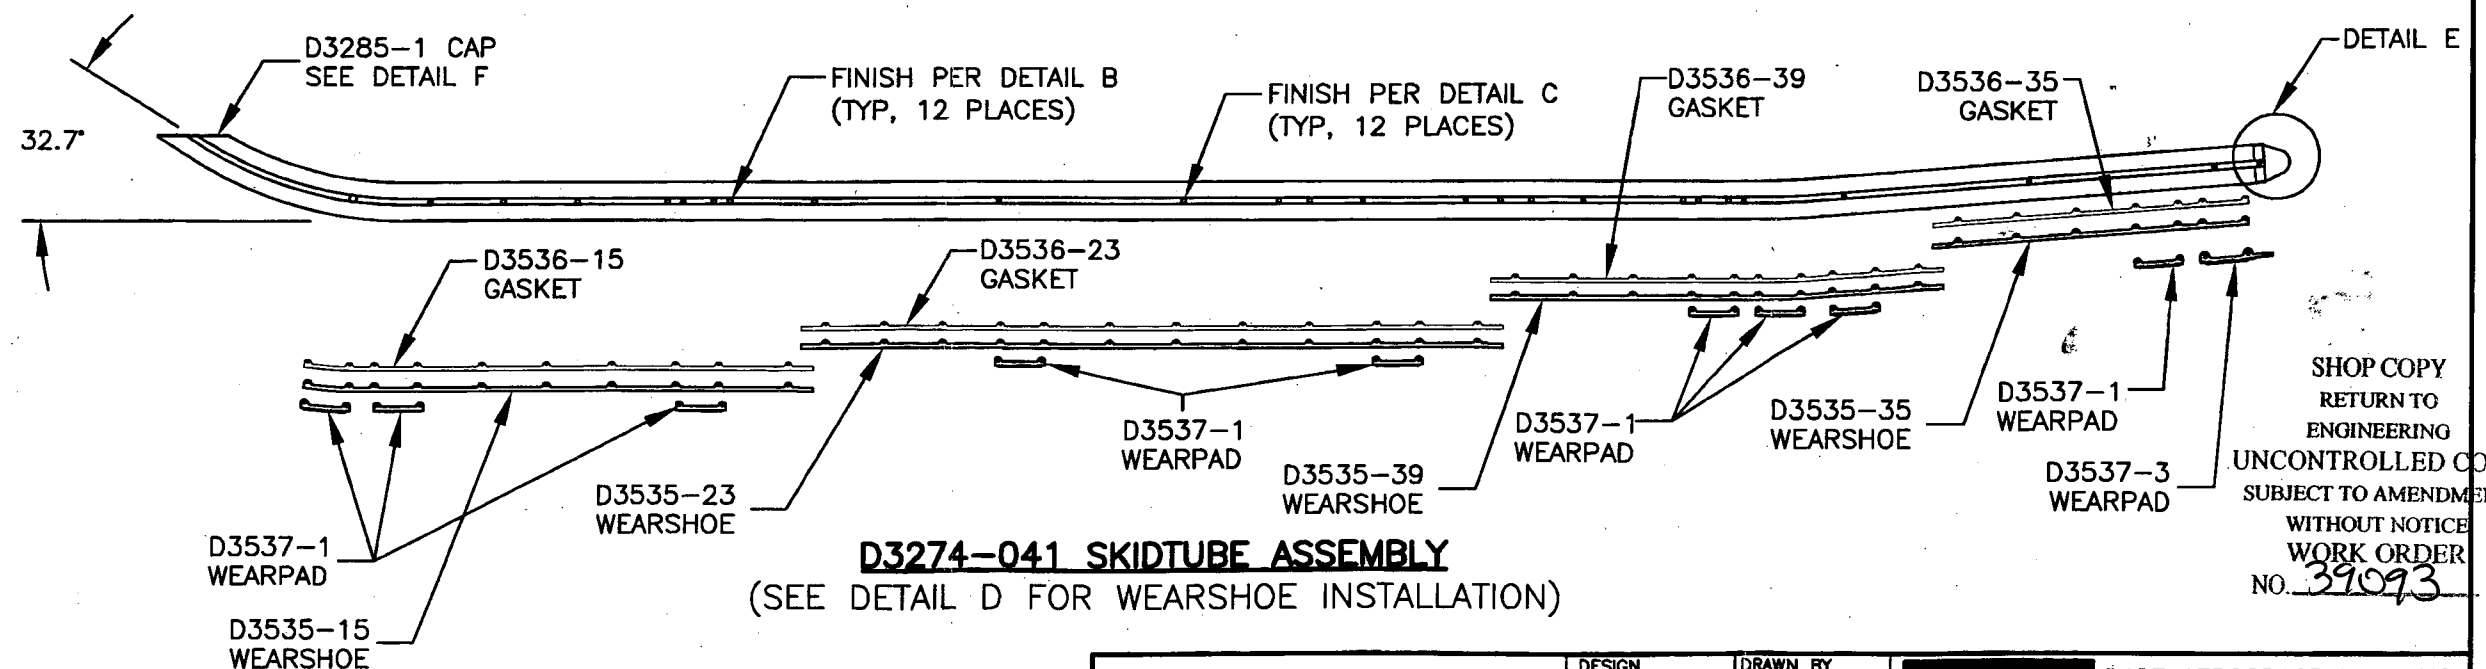

**D3274-041 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)


RELEASED

07.02.12


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC.
CHECKED	#	APPROVED	#	PORT HADLOCK, WA
DATE	06.12.19	DRAWING NO.	D3274	REV. D
TITLE	SKIDTUBE ASSEMBLY			SHEET 2 OF 4
				SCALE 1:15

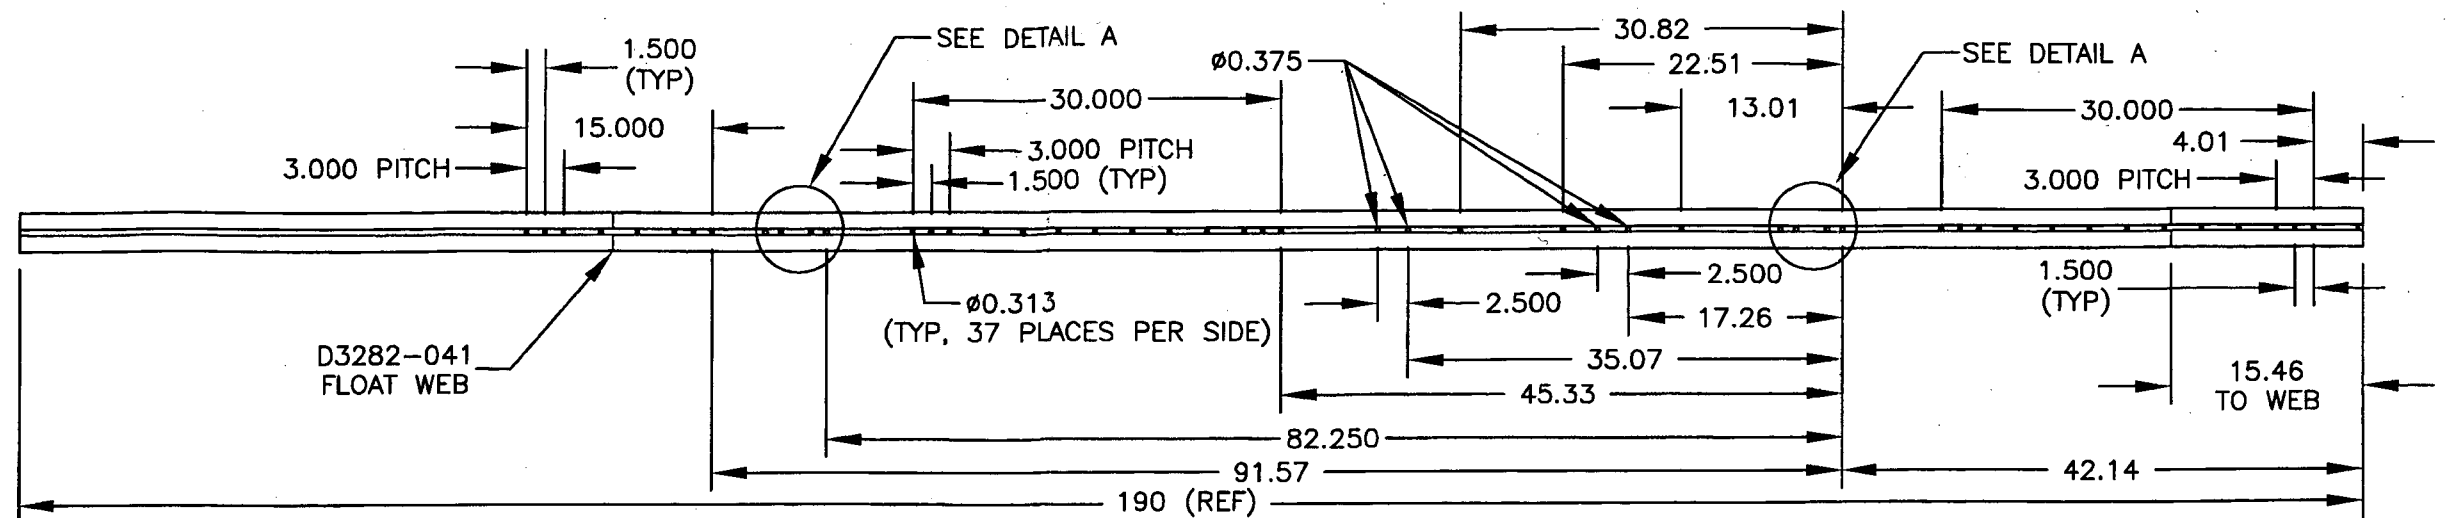

**D3274-043 DRILLING/ASSEMBLY DETAIL**

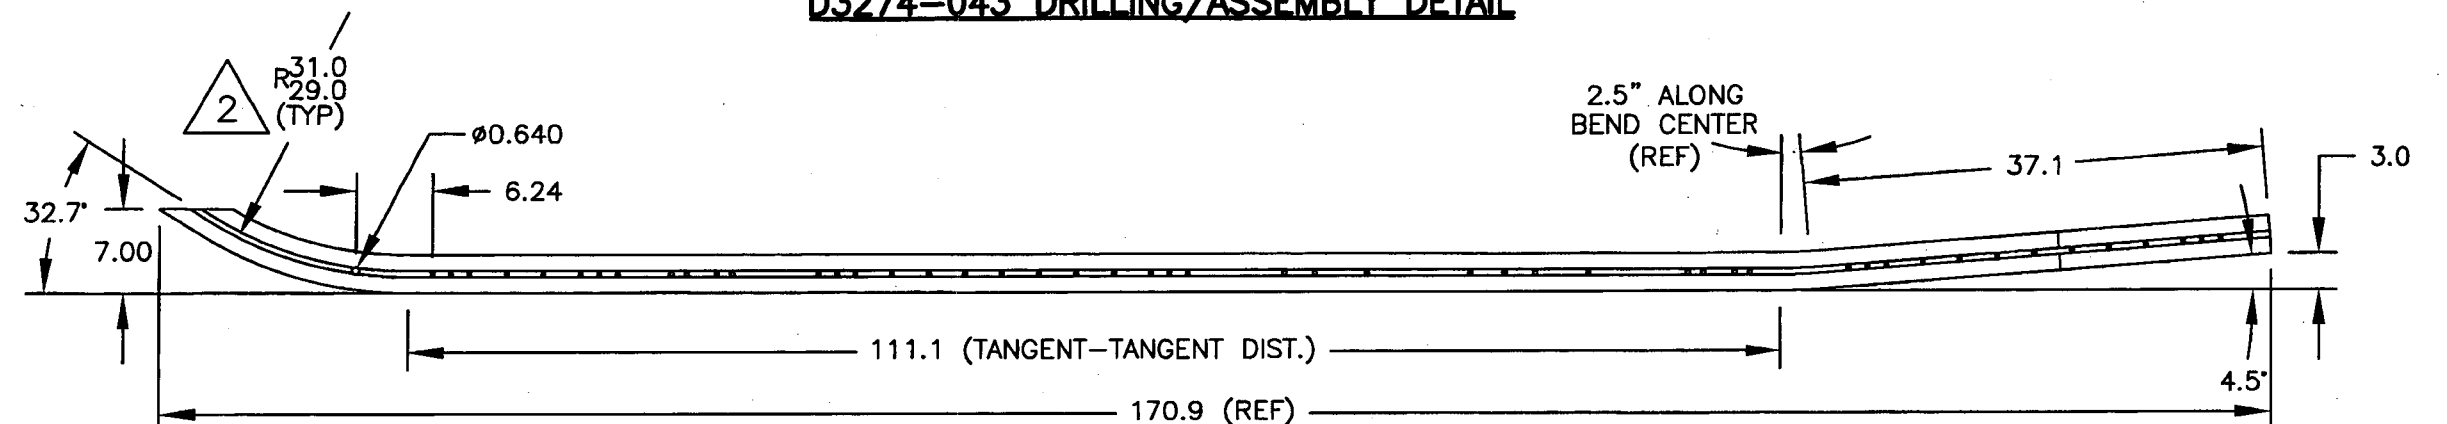

**D3274-043 BEND/DRILLING DETAIL**

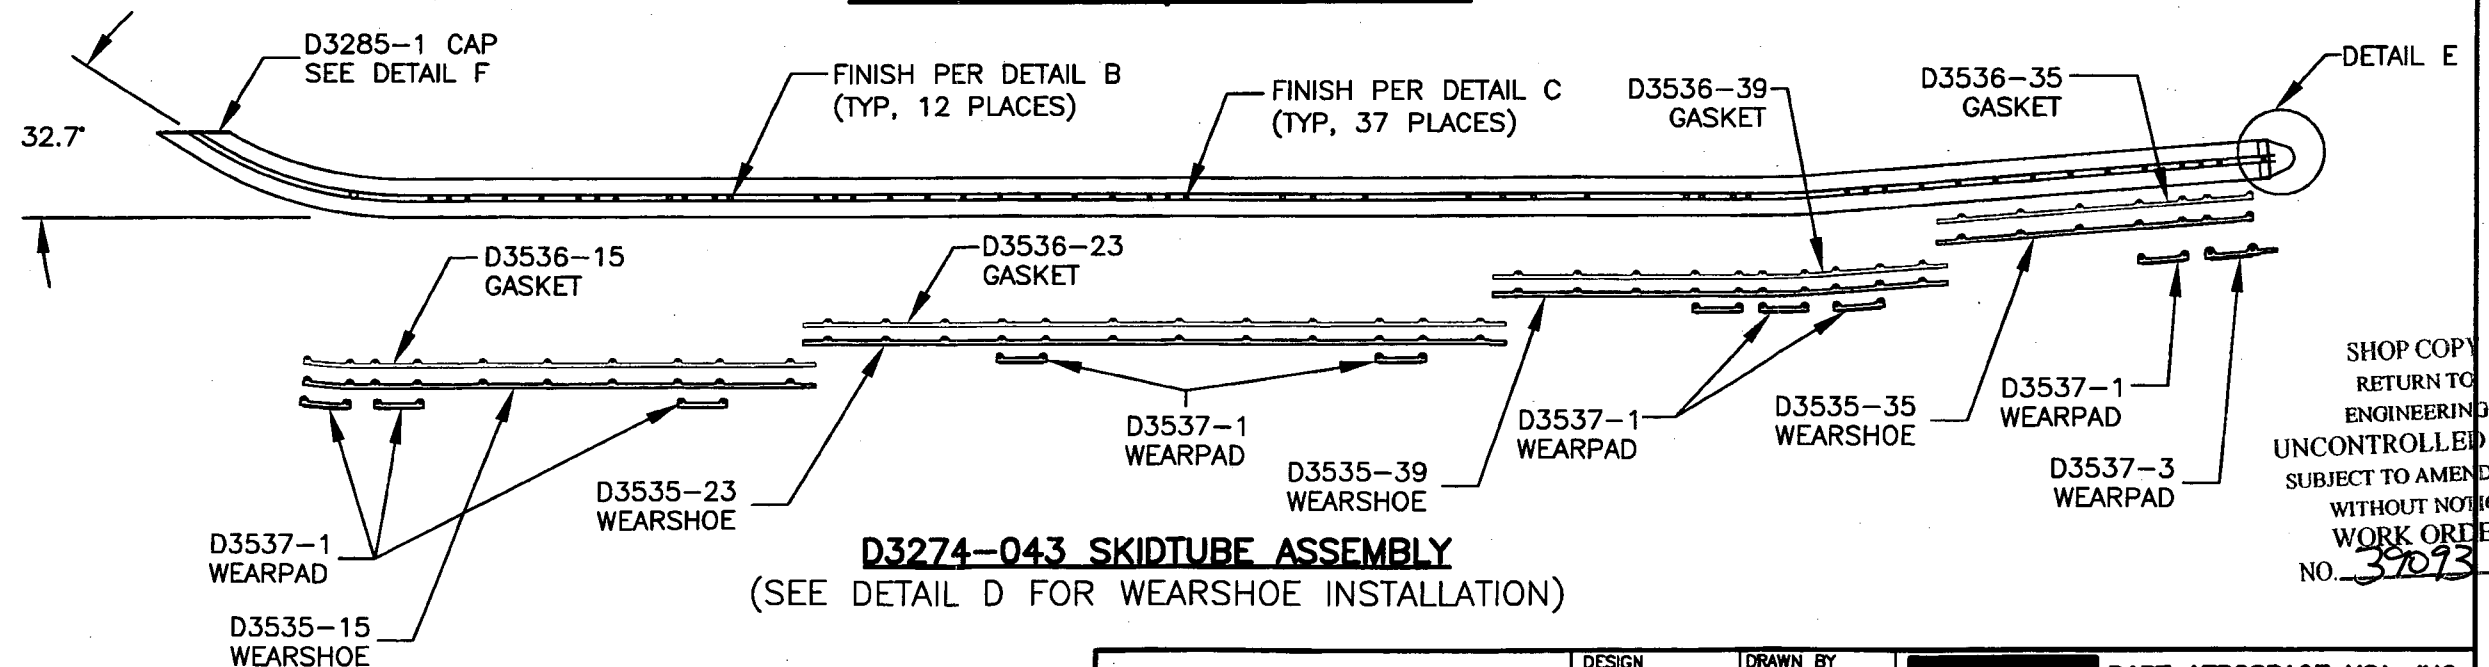

**D3274-043 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 39093

RELEASED


07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN CP	DRAWN BY PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED H	APPROVED H	DRAWING NO. D3274
DATE 06.12.19	TITLE SKIDTUBE ASSEMBLY	REV. D SHEET 3 OF 4 SCALE 1:15

# **DETAIL A: DRILL DETAIL**

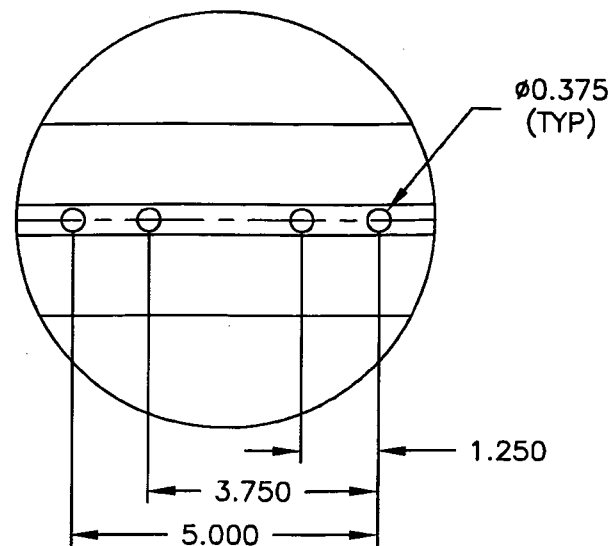


# **DETAIL B** FOR $\phi 0.375$ HOLES ONLY

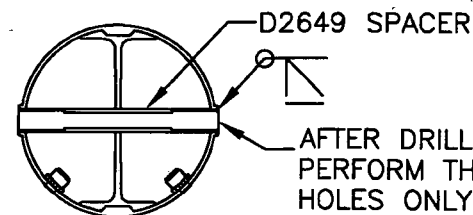


- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR  $\phi 0.375$   
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
  2. INSERT D2649 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE TO  $\phi 0.313 \times 0.75$  DEEP


# **DETAIL C** FOR $\phi 0.313$ HOLES ONLY

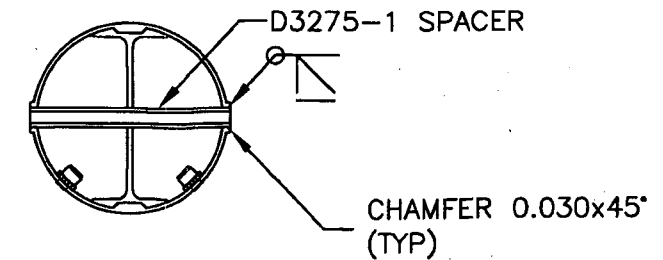


# **DETAIL D**

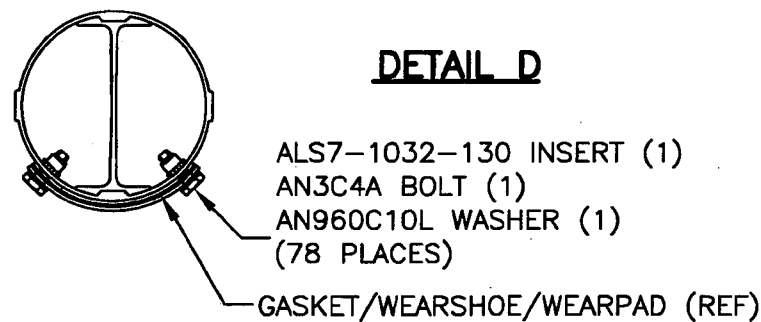

# **DETAIL E**

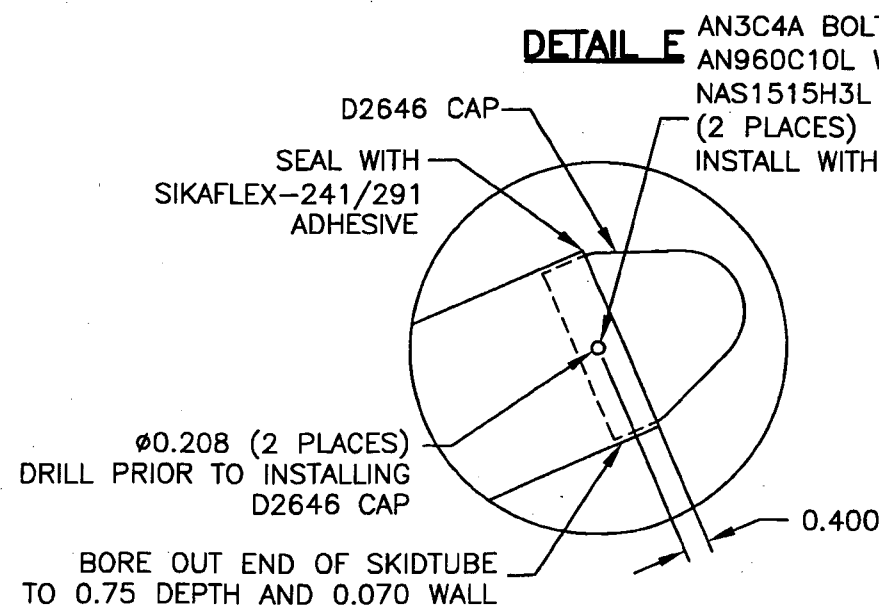

# **DETAIL F: END FINISHING DETAIL**

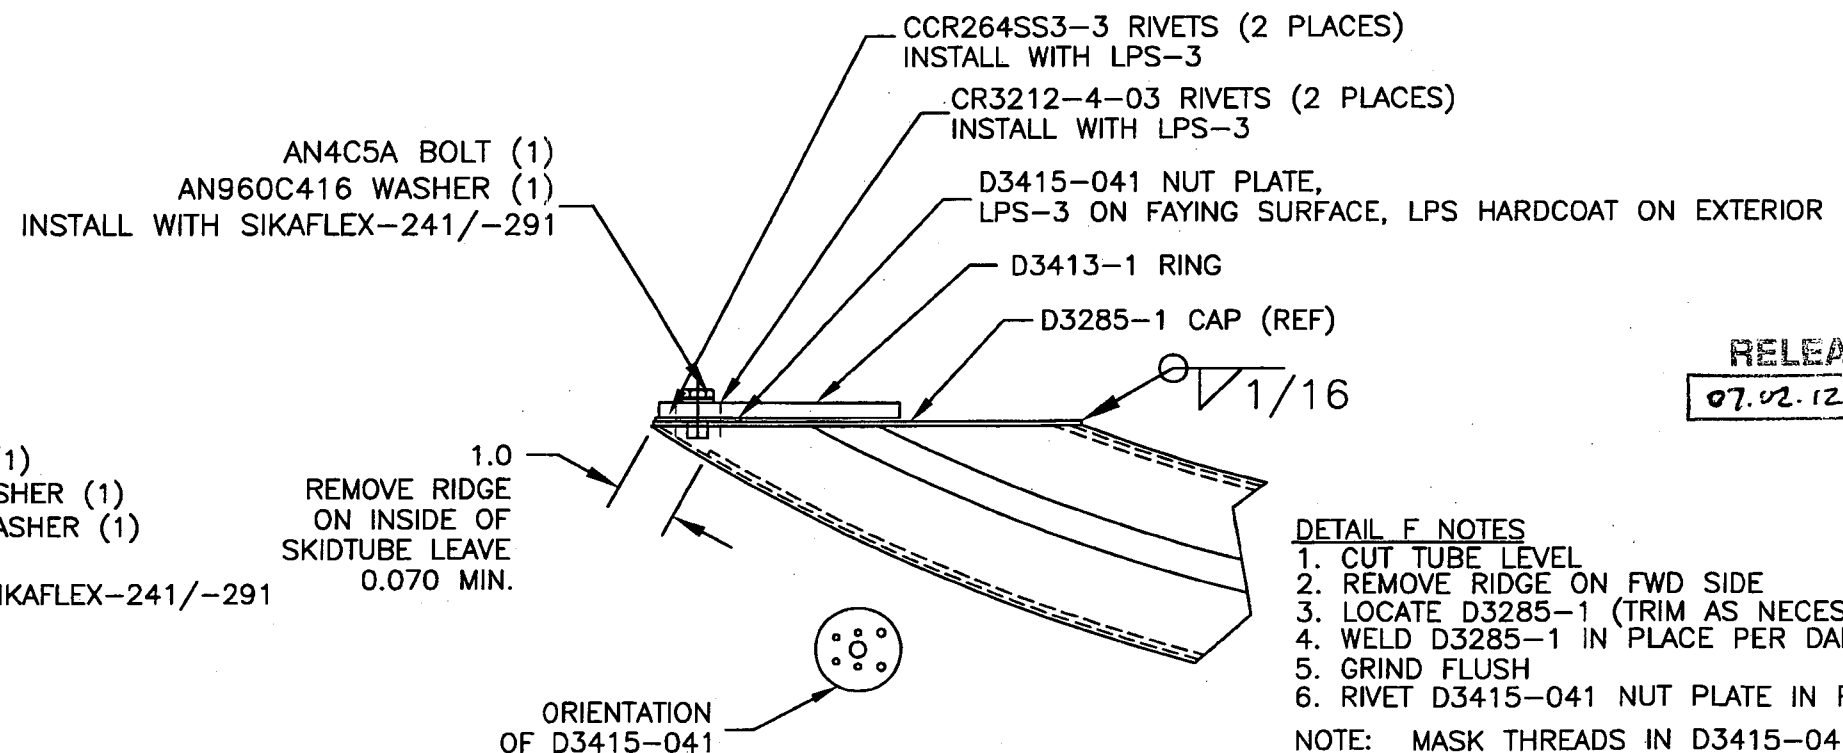

# **DETAIL F NOTES**

1. CUT TUBE LEVEL
  2. REMOVE RIDGE ON FWD SIDE
  3. LOCATE D3285-1 (TRIM AS NECESSARY)
  4. WELD D3285-1 IN PLACE PER DART QSI 004
  5. GRIND FLUSH
  6. RIVET D3415-041 NUT PLATE IN PLACE
- NOTE: MASK THREADS IN D3415-041  
PRIOR TO FINISH

RELEASED  
07.02.12

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED CO  
SUBJECT TO AMENDME  
WITHOUT NOTICE  
WORK ORDER  
NO. 39093

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	PH	DRAWING NO. D3274	REV. D SHEET 4 OF 4
		DATE	06.12.19		TITLE SKIDTUBE ASSEMBLY		SCALE 1:3

